

## Schluter VINPRO-U Molding Installation Instructions

1. Select the profile according to resilient covering thickness. It is recommended to choose a profile height up to a 0.5 mm greater than the floor covering thickness.

2. Place the profile in its desired position and mark the edges of the profile onto the substrate.

### 3.a. Adhesive Installation

Apply Schluter®-KERDI-FIX or an equivalent adhesive to the backside of the anchoring leg, according to the manufacturer's installation instructions. Press the anchoring leg onto the substrate and align to the desired position. Be sure to remove any excess adhesive promptly.

### 3b. Fastened Installation

Align the profile in the desired position and fasten to the substrate through the holes in the anchoring leg. Recommended screw: #6 / M3.5 flat head screws, minimum length - 3/4" (19 mm). Be sure to install the fasteners so that the screw head is flush with the anchoring leg surface, preventing it from transferring through to the finished surface.

For concrete substrates: The use of anchors is recommended. First, place the profile in its desired position and mark the hole locations onto the substrate. Next, drill pilot holes at the marked locations and install the anchors according to the manufacturer's instructions. Be sure that the anchor size is suitable for the selected fastener prior to the installation.

4. A patching/leveling compound can be used to eliminate inconsistencies in the floor and anchoring leg if required. Please refer to the patching/leveling compound manufacturer's installation instructions.

5. Install resilient covering according to the manufacturer's installation instructions, with recommended edge spacing. Be sure to cut the adjacent covering accordingly to fit within the pocket of the profile.

6. When installing with adhesives or grouting materials, remove any residue from the visible surface of the profile quickly.